

Work Order ID 152052

Wednesday, October 19, 2016 1:01:38 PM

152052** Eng testing **

Page 1

Item ID: D205-634-141**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Item Name:** Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH**Stop*****NS2*****Start Date:** 11/1/2016 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 11/9/2016 **Req'd Qty:** 1.00***1*****Customer:****Reference:** RD16-682-01**Approvals:** **Process Plan:** *VS***Date:** *16/10/19***Tooling:****Date:****Run Start*****NR1*****QC:****Date:****SPC (Y/N):****Date:****Stop*****NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D2580-047	G								
100	Document Control	0.00							
100	DOCUMENT CONTROL								
DC	Memo	0.00							
Doc.Control -USB or Paperwork	Photocopy D205-634 bluefile & type labels per PPP D205-634-141	CHG004							
110	Skidtubes	0.00							
110									
Skidtubes	Memo	0.10							
Skidtubes	1- PICK D2580-1								
	2- SPOT DRILL 2 AFT RUN ON WEARPLATE HOLES USING DT10021, DRILL 3.630" HOLES USING DT8462 (83.94" FROM AFT OF D2580-1 REF. ONLY)								

*N/A 9/16/10/26**> 16-11-2***DAS
19
9-80**

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐				
Misidentified ☐	Past Due ☐	OTHER : ☐			

Work Order ID 152052

Wednesday, October 19, 2016 1:01:38 PM

152052

Page 2

Item ID: D205-634-141

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH

Start Date: 11/1/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/9/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference: RD16-682-01

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	BENDING MACHINE - SKIDTUBES	0.00							
120 CNC Bend 1 CNC Delta 100 Bender	Memo 1-Bend as per program D2580.C on CNC Bender and Folio FT 16 2-Cut tubes as per Dwg. D2580 3- Scribe batch# in aft end of tube	0.13							
130	Skidtubes	0.00							
130 Skidtubes Skidtubes	Memo 1-Deburr ends after cutting and remove bending marks. Prepare tube for welding D2576-3 step remove alodine as required. 2-Locating from most fwd saddle hole, drill most fwd wearplate hole using DT9793 (10.832 REF) as per dwg D2580 sheet 7. 3-Open run-on wearplate holes to finished size 0.508" at locations (5.338/ 5.985/ 10.832/ 3.63 REF) as per dwg D2580 sheet 7. 4-Drill pilot holes for aft cap using DT8215, Open to finished size.	0.23							

16-11-2016 / [Signature]

1 [Signature] 16-11-07

No stop 11/10/26

OK N/A

[Signature] TX

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition				
					Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : ☐						

Work Order ID 152052

Wednesday, October 19, 2016 1:01:38 PM

152052

Page 3

Item ID: D205-634-141 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH
Start Date: 11/1/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/9/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference: RD16-682-01

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC5- Inspect part completeness to step on W/O	0.00							
140									
QC	Memo	0.00							
Quality Control									
150		0.00							
150	Skidtubes								
Skidtubes	Memo	0.20							
Skidtubes	1- Weld step D2576 as per Dwg. D2580 and QSI 004 A/R Aluminum Rod								
	2- Touch up alodine on run on wearplate holes prior to swaging								
	3- Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002 and as per dwg								
	4- DRILL TOWING HOLE USING DT8091								
	5- DEBURR								

Handwritten notes:

- No step 9/16/10/26*
- 1 16-11-07*
- DT8217 and DT8937 for wearplates and open to .297*
- DT8217 and DT8937 for wearplates and open to .297*
- DT8217 and DT8937 for wearplates and open to .297*

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																																																																																																														
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																																																																																																												
Description Work Order Deviation		Disposition																																																																																																																																														
				Completed By																																																																																																																																												
				Lead hand / Supervisor Approval Verification																																																																																																																																												
				QC / QA Coordinator Approval																																																																																																																																												
<table border="1" style="width:100%; border-collapse: collapse;"> <thead> <tr> <th colspan="3" style="text-align: left;">Root Cause</th> <th colspan="4" style="text-align: left;">FAULT CATEGORY</th> </tr> </thead> <tbody> <tr> <td>Environment ☐</td> <td>☐</td> <td>No Re-verification</td> <td>☐</td> <td>Pressure/Forced</td> <td>☐</td> <td>Temperature/Cure</td> <td>☐</td> <td>Power Loss/Surge</td> <td>☐</td> <td>Positioned Wrong</td> </tr> <tr> <td>Design ☐</td> <td>☐</td> <td>Operator</td> <td>☐</td> <td>Bending</td> <td>☐</td> <td>Set-up</td> <td>☐</td> <td>Folio/Program</td> <td>☐</td> <td>Outside Dimensions</td> </tr> <tr> <td>Doc/Data ☐</td> <td>☐</td> <td>Offset/Setup</td> <td>☐</td> <td>Centre Not Concentric</td> <td>☐</td> <td>BOM/Route</td> <td>☐</td> <td>Grain</td> <td>☐</td> <td>Over/Under tolerance</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>☐</td> <td>Supplier</td> <td>☐</td> <td>Cracks</td> <td>☐</td> <td>Broken/Damage/Defect</td> <td>☐</td> <td>Weld</td> <td>☐</td> <td>Part Incorrect</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>☐</td> <td>Training</td> <td>☐</td> <td>Crimp/Kink/Ripple/Wave</td> <td>☐</td> <td>Inspection Incomplete/Unqualified</td> <td>☐</td> <td>Wrong Stock Pulled</td> <td>☐</td> <td>Part Lost/Missing</td> </tr> <tr> <td>Material ☐</td> <td>☐</td> <td>Use for Testing</td> <td>☐</td> <td>Cuffs</td> <td>☐</td> <td>Contamination</td> <td>☐</td> <td>Out of Sequence</td> <td>☐</td> <td>Part Moved</td> </tr> <tr> <td>Internal Transport ☐</td> <td>☐</td> <td>Poor Information</td> <td>☐</td> <td>Crushing</td> <td>☐</td> <td>Countersink</td> <td>☐</td> <td>Off-set</td> <td>☐</td> <td>Drawing</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>☐</td> <td>Rushing</td> <td>☐</td> <td>Heat Treat</td> <td>☐</td> <td>Cut Too Short</td> <td>☐</td> <td>Mislabeled</td> <td>☐</td> <td>Finish</td> </tr> <tr> <td>LOA ☐</td> <td>☐</td> <td>Product Improvement</td> <td>☐</td> <td>Wave/Twist in Tube</td> <td>☐</td> <td>Instructions Incomplete/Unclear</td> <td>☐</td> <td>Fit/Function</td> <td>☐</td> <td>Misread</td> </tr> <tr> <td>Substation ☐</td> <td>☐</td> <td>Process Improvement</td> <td>☐</td> <td>Marks/Chatter</td> <td>☐</td> <td>Drill Holes</td> <td>☐</td> <td>Misaligned/off center</td> <td>☐</td> <td>Turning Sequence</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>☐</td> <td>Manufacturing Process</td> <td colspan="8"></td> </tr> <tr> <td>Misidentified ☐</td> <td>☐</td> <td>Past Due</td> <td colspan="8">OTHER :</td> </tr> </tbody> </table>						Root Cause			FAULT CATEGORY				Environment ☐	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	Design ☐	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	Doc/Data ☐	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	Equip/Tooling ☐	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	Handling/Pre ☐	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	Material ☐	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	Internal Transport ☐	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	Tribal Knowledge ☐	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	LOA ☐	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	Substation ☐	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	Past Expiry Date ☐	☐	Manufacturing Process									Misidentified ☐	☐	Past Due	OTHER :							
Root Cause			FAULT CATEGORY																																																																																																																																													
Environment ☐	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong																																																																																																																																						
Design ☐	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions																																																																																																																																						
Doc/Data ☐	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance																																																																																																																																						
Equip/Tooling ☐	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect																																																																																																																																						
Handling/Pre ☐	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing																																																																																																																																						
Material ☐	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved																																																																																																																																						
Internal Transport ☐	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing																																																																																																																																						
Tribal Knowledge ☐	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish																																																																																																																																						
LOA ☐	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread																																																																																																																																						
Substation ☐	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence																																																																																																																																						
Past Expiry Date ☐	☐	Manufacturing Process																																																																																																																																														
Misidentified ☐	☐	Past Due	OTHER :																																																																																																																																													

Work Order ID 152052

Wednesday, October 19, 2016 1:01:38 PM

152052

Page 4

Item ID: D205-634-141

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH

Start Date: 11/1/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/9/2016 Req'd Qty: 1.00

1

Customer:

Reference: RD16-682-01

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start

NR1

QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

160

QC10- Inspect visual per QSI004- ground welds

0.00

160

QC

Memo

0.00

Quality Control

No weld 9/16/10/26

170

QC5- Inspect part completeness to step on W/O

0.00

170

QC

Memo

0.00

Quality Control

DAS
38
9-89

NOV 08 2016

180

Pressure Wash per QSI005 4.3

0.00

180

HandFinish

Memo

0.08

Hand Finishing

And realodine tube as per QSI 005

(X1)

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 152052***152052***

Page 5

Wednesday, October 19, 2016 1:01:38 PM

Item ID: D205-634-141**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Stop *NS2*****Item Name:** Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH**Start Date:** 11/1/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 11/9/2016 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:** RD16-682-01**Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190 *190* Powdercoat Powder Coating	White Gloss(Ref:433.5.1) per QSI005 4.3-Alum Memo START TIME: _____ OVEN TEMPERATURE: _____ FINISH TIME: _____	0.00 0.04	N/A	9/16/10/26					
200 *200* QC Quality Control	QC3- Inspect Part Finish Memo	0.00 0.00	N/A	9/16/10/26					

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval 	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 152052

Wednesday, October 19, 2016 1:01:38 PM

***152052***

Page 6

Item ID: D205-634-141**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Stop*****NS2*****Item Name:** Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH**Start Date:** 11/1/2016 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 11/9/2016 **Req'd Qty:** 1.00***1*****Customer:****Reference:** RD16-682-01**Approvals:****Process Plan:** _____**Date:** _____**Tooling:** _____**Date:** _____**Run Start*****NR1*****QC:** _____**Date:** _____**SPC (Y/N):** _____**Date:** _____**Stop*****NR2*****Sequence ID/
Work Center ID****Operation
Description****Set Up/
Run Hours****Tool ID****Tool #****Plan
Code****Accept
Qty****Reject
Qty****Reject
Number****Insp.
Stamp**

210

Assemble as per dwg
HandFinishing

0.00

210

HandFinish

Memo

0.26

1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on
insert holes before installing wearplates
A/R Sikaflex-291 11/3/09
Sikaflex expire date: 1/3/09*INSTALL WEARPLATES PER
D2580-041*~~2-Coat D2594-3 O-rings with Petroleum Jelly and install on D2594~~*No plug*~~3-Install aft cap as per dwg~~*No cap*~~4- Wing walk as per dwg Batch#~~*No wing walk*

220

QC5- Inspect part completeness to step on W/O

0.00

220

QC

Memo

0.00

Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for
Foreign objects per QSI 024DAS
38
9-89

NOV 21 2016

POSITIVE RECALL**EFFECTIVE** 16-18-15 **AUTH** SAD**RELEASED** _____ **DATE** _____

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY			
Environment ☐	☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	
Design ☐	☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	
Doc/Data ☐	☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	
Equip/Tooling ☐	☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	
Handling/Pre ☐	☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	
Material ☐	☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	
Internal Transport ☐	☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	
Tribal Knowledge ☐	☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	
LOA ☐	☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	
Substation ☐	☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	
Past Expiry Date ☐	☐	Manufacturing Process ☐	OTHER : _____				
Misidentified ☐	☐	Past Due ☐					

Work Order ID 152052***152052***

Page 7

Wednesday, October 19, 2016 1:01:38 PM

Item ID: D205-634-141**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Stop*****NS2*****Item Name:** Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH**Start Date:** 11/1/2016 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 11/9/2016 **Req'd Qty:** 1.00***1*****Customer:****Reference:** RD16-682-01**Approvals:****Process Plan:** _____**Date:** _____**Tooling:** _____**Date:** _____**Run Start*****NR1*****QC:** _____**Date:** _____**SPC (Y/N):** _____**Date:** _____**Stop*****NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230	Packaging	0.00							
230									
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPPD205-634-141 Location : FG084								
240	QC21- Final Inspection - Work Order Release	0.00							
240									
QC	Memo	0.02							
Quality Control									

N/A 11/16/10/26
FOR TESTRD16-682-01
11/16-12-06

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition				
					Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : ☐						

Picklist Print

Wednesday, October 19, 2016 1:01:47 PM

Work Order ID: 152052

152052

Parent Item: D205-634-141

D205-634-141

Parent Item Name: Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH

Start Date: 11/1/2016

Required Date: 11/9/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA 11.09.14 new issue EC verified by:DD IPP REV:B
12.01.23 AS PER ECN11-684 DD VERF:EC IPP REV:C 13.03.21
AS PER ECN13-544 DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2580-1		Manufactured	No			110	Each	0.0000	1	1			
D2580-1													
205 Bent Tube													
D4202-1		Manufactured	No			150	Each	177.0000	24	24			
D4202-1													
Spacer													

				<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>							
				LG001	177								
				145902	5								
				147952	172								
AN4-45A		Purchased	No		210	Each	44.0000	8	8				
AN4-45A													
BOLT													

	<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
	FP001	44	
	m134509	16	
	m135127	28	

N/A
16-12-6

16-11-07

DAS
19
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER :			

Picklist Print

Wednesday, October 19, 2016 1:01:47 PM

Page 2

Work Order ID: 152052

152052

Parent Item: D205-634-141

D205-634-141

Parent Item Name: Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH

Start Date: 11/1/2016

Required Date: 11/9/2016

Start Qty: 1.00

Required Qty: 1.00

D2570 Manufactured No 210 Each 388.0000 16 16

D2570

Bushing

Location	Loc Qty	Loc Code
FG	12	
88781	12	
FP001	27	
147395	27	
ST008	349	
145728	2	
148174	37	
150641	310	

D4406-041 Manufactured No 210 Each 5.0000 1 1

D4406-041

Fwd Wearplate Assembly

Location	Loc Qty	Loc Code
FP002	5	
143619	5	
210	Each	

D4406-043 Manufactured No 210 Each 4.0000 1 1

D4406-043

Aft Wearplate Assembly

Location	Loc Qty	Loc Code
FP002	4	
147619	4	

MS21042-4 MS21042L4 Purchased No 210 Each 2.0000 8 8

MS21042-4

Nut

Location	Loc Qty	Loc Code
ST304	2	
9063	2	

Wednesday, October 19, 2016 1:01:47 PM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐			

Picklist Print

Page 3

Wednesday, October 19, 2016 1:01:47 PM

Work Order ID: 152052

152052

Parent Item: D205-634-141

D205-634-141

Parent Item Name: Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH

Start Date: 11/1/2016

Required Date: 11/9/2016

Start Qty: 1.00

Required Qty: 1.00

D2576-3

Manufactured No

150 Each

93.0000

1

1

D2576-3

Step (Machining Detail)

******LocationLoc QtyLoc Code

LG001

93

144673

7

148337

36

151399

50

D2855

Manufactured No

210 Each

105.0000

1

1

D2855

Cap

******LocationLoc QtyLoc Code

FP001

105

137568

1

147805

104

AN3-5A

Purchased No

210 Each

280.0000

2

2

AN3-5A

Bolt

******LocationLoc QtyLoc Code

FP001

155

m134502

155

ST350

125

m135058

125

Wednesday, October 19, 2016 1:01:47 PM

Shop Packet Print

Page 3

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			

Root Cause			FAULT CATEGORY		
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐				

Picklist Print

Wednesday, October 19, 2016 1:01:47 PM

Work Order ID: 152052

152052

Parent Item: D205-634-141

D205-634-141

Parent Item Name: Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH

Start Date: 11/1/2016

Required Date: 11/9/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1149D0332J

Purchased

No

210

Each

1,189.000

2

2

NAS1149D0332.J

Washer

Location

Loc Qty

Loc Code

CA

6

m129682

6

FP001

196

m134848

196

GA

222

m134848

222

ST260a

600

m135672

600

ST264

165

m135536

31

m135566

134

210

Each

562.0000

8

8

D2594-3

Manufactured

No

D2594-3

O-Ring

Location

Loc Qty

Loc Code

FP001

562

135859

24

138060

2

140770

2

145268

500

147875

34

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐			

Picklist Print

Wednesday, October 19, 2016 1:01:47 PM

Page 5

Work Order ID: 152052

152052

Parent Item: D205-634-141

D205-634-141

Parent Item Name: Replacement Skidtube with Run-On Landing Wearplates Fits LH or RH

Start Date: 11/1/2016

Required Date: 11/9/2016

Start Qty: 1.00

Required Qty: 1.00

D2594-1

Manufactured No

210

Each

417.0000

8

8

D2594-1

Plug

Location

Loc Qty

Loc Code

FP001

417

119830

68

134804

16

146645

85

147564

1

147974

7

148319

105

150991

100

151587

3

42807

25

88922

7

N/A 11/16/12-6

Wednesday, October 19, 2016 1:01:47 PM

Shop Packet Print

Page 5

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			

Root Cause			FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date	☐	Manufacturing Process	☐	OTHER :						
Misidentified	☐	Past Due	☐							

LIST OF MATERIALS						PART NUMBER	DESCRIPTION
ITEM	QTY -041	QTY -045	QTY -047	QTY -049			
1	X					D2580-041	SKIDTUBE ASSEMBLY
2		X				D2580-045	SKIDTUBE ASSEMBLY
3			X			D2580-047	SKIDTUBE ASSEMBLY
4				X		D2580-049	SKIDTUBE ASSEMBLY
20	1	1	1	1		D2500-1-190	EXTRUSION
21			16	16		D2570	BUSHING
22	1	1	1	1		D2576-3	STEP
23		4				D2579	SPACER
24	16	16	8	8		D2594-1	PLUG
25	16	16	8	8		D2594-3	O-RING
26	1	1	1	1		D2596	205 WEB
27	1	1	1	1		D2855	AFT CAP
28	1	1				D3564-5	WEARSHOE
29	1	1				D3564-9	WEARSHOE
30	1	1				D3564-11	WEARSHOE
31	1	1				D3564-13	WEARSHOE
32	2	2				D3566-1	GASKET
33	1	1				D3566-5	GASKET
34	1	1				D3566-13	GASKET
35	20	20	24	24		D4202-1	SPACER
36			1			D4406-041	WEARPLATE ASSEMBLY
37			1			D4406-043	WEARPLATE ASSEMBLY
37				1		D5061-1	FWD WEARPLATE
37				1		D5061-3	AFT WEARPLATE
50	50	50				ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
51	50	50				AN3C4A	BOLT
52	2	2	2	2		AN3-3A	BOLT
53			8	8		AN4-45A	BOLT
54	50	50				NAS1149C0332R	WASHER (AN960C10L)
55	2	2	2	2		NAS1149D0332J	WASHER (AN960JD10L)
56			8	8		MS21042-4	NUT (OR MS21042L4)

GENERAL NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY (-041/-047/-049) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3 POWDER COAT ASSEMBLY (-045) GREEN SANDEX (REF 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 34.5 lbs
D2580-045 = 34.5 lbs
D2580-047 = 45.1 lbs
D2580-049 = 32.0 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241-291.
- 12) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047/-049)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

RELEASED
2014-04-29

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 152052

16/10/19

G	ADDED -049, -047 WEIGHT UPDATED PER DSI 9598	AJS	14.04.09
F	INCORPORATE DEO D2580-E-1 PER PAR12-218	DC	13.06.20
E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.16
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	N	D2580	SHEET 1 OF 9
APPROVED	14	TITLE	SCALE
DE APPR.	14	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1988 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. WHO IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
						QC / QA Coordinator Approval			

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____							
Misidentified	☐	Past Due	☐								

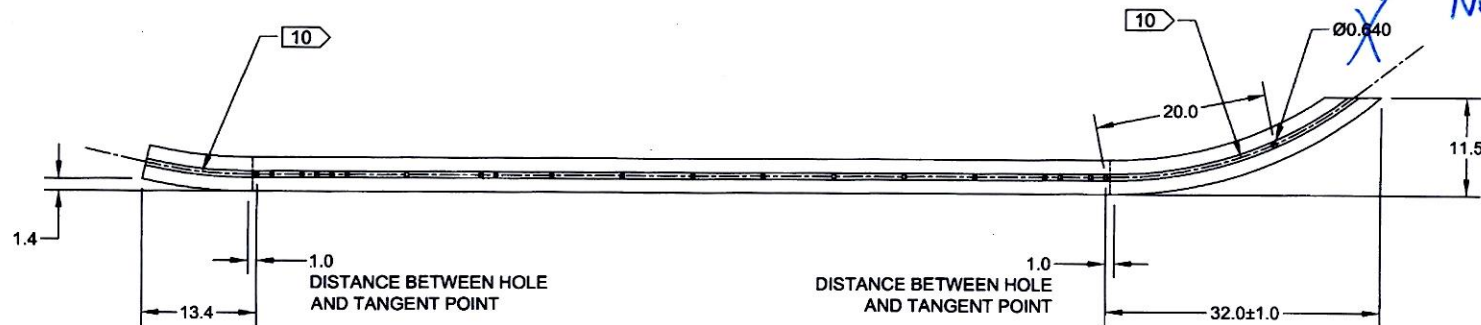

D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.		D2580	SHEET 3 OF 9
APPROVED		TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1998 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : _____			

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE




QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval					

Root Cause				FAULT CATEGORY			
Environment ☐		No Re-verification ☐		Pressure/Forced ☐		Temperature/Cure ☐	
Design ☐		Operator ☐		Bending ☐		Set-up ☐	
Doc/Data ☐		Offset/Setup ☐		Centre Not Concentric ☐		BOM/Route ☐	
Equip/Tooling ☐		Supplier ☐		Cracks ☐		Broken/Damage/Defect ☐	
Handling/Pre ☐		Training ☐		Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐	
Material ☐		Use for Testing ☐		Cuffs ☐		Contamination ☐	
Internal Transport ☐		Poor Information ☐		Crushing ☐		Countersink ☐	
Tribal Knowledge ☐		Rushing ☐		Heat Treat ☐		Cut Too Short ☐	
LOA ☐		Product Improvement ☐		Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐	
Substation ☐		Process Improvement ☐		Marks/Chatter ☐		Drill Holes ☐	
Past Expiry Date ☐		Manufacturing Process ☐		OTHER : _____			
Misidentified ☐		Past Due ☐					

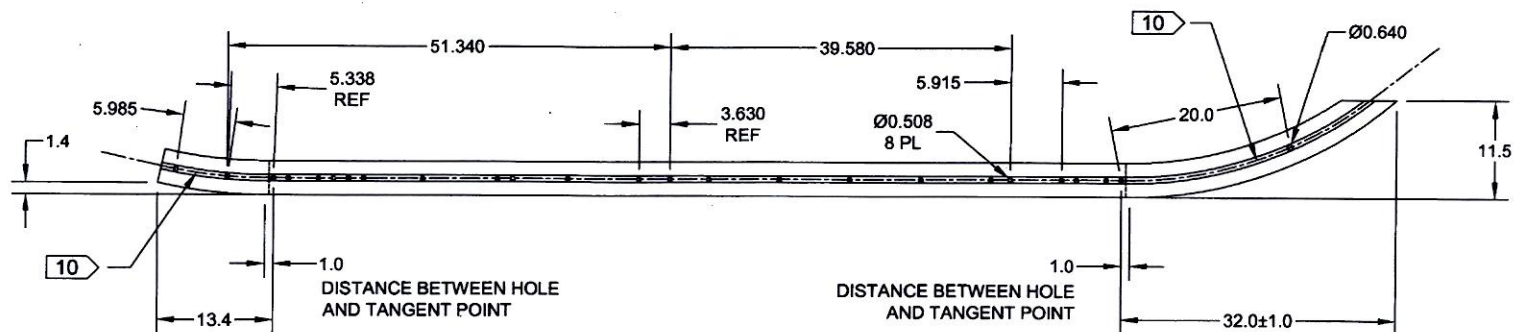

D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	<i>A.P.</i>	DRAWING NO.	REV. G
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 5 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval					


Root Cause				FAULT CATEGORY			
Environment ☐		No Re-verification ☐		Pressure/Forced ☐		Temperature/Cure ☐	
Design ☐		Operator ☐		Bending ☐		Set-up ☐	
Doc/Data ☐		Offset/Setup ☐		Centre Not Concentric ☐		BOM/Route ☐	
Equip/Tooling ☐		Supplier ☐		Cracks ☐		Broken/Damage/Defect ☐	
Handling/Pre ☐		Training ☐		Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐	
Material ☐		Use for Testing ☐		Cuffs ☐		Contamination ☐	
Internal Transport ☐		Poor Information ☐		Crushing ☐		Countersink ☐	
Tribal Knowledge ☐		Rushing ☐		Heat Treat ☐		Cut Too Short ☐	
LOA ☐		Product Improvement ☐		Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐	
Substation ☐		Process Improvement ☐		Marks/Chatter ☐		Drill Holes ☐	
Past Expiry Date ☐		Manufacturing Process ☐		OTHER : _____			
Misidentified ☐		Past Due ☐					

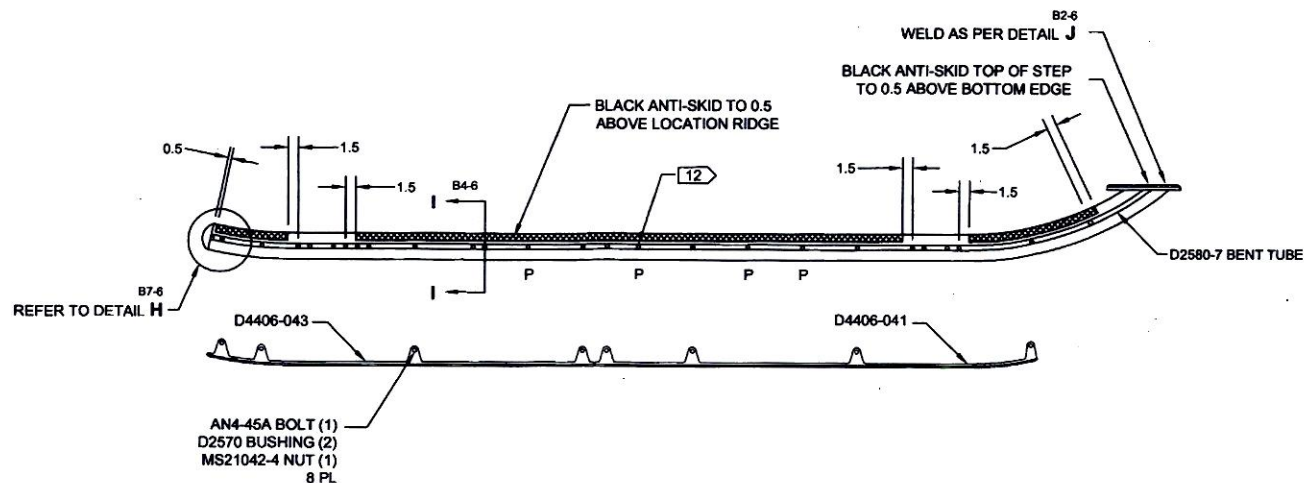


D2580-047 ASSEMBLY DETAIL

RELEASED
2014-04-29

DETAIL H C8-6
SCALE 5X

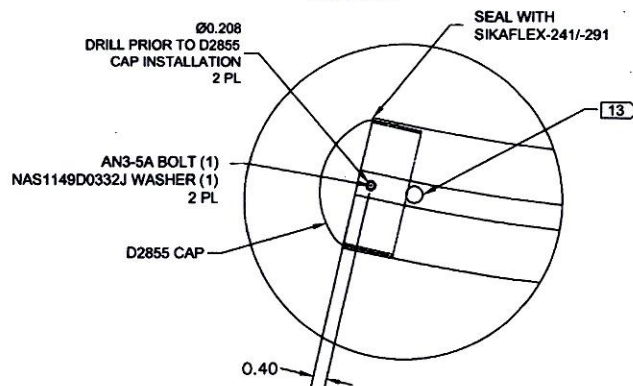


SECTION I-I D5-6
SCALE 5X

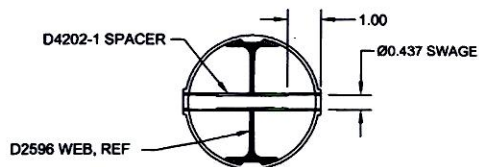

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

DETAIL J D3-6
SCALE 5X

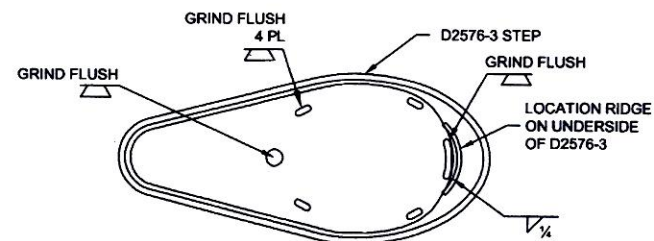

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.		D2580	SHEET 6 OF 9
APPROVED		TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					



DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>AP</i>	DRAWING NO.	REV. C
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 7 OF 7
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NT
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE LTD.	

DQA: _____ Date: _____


WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : _____			

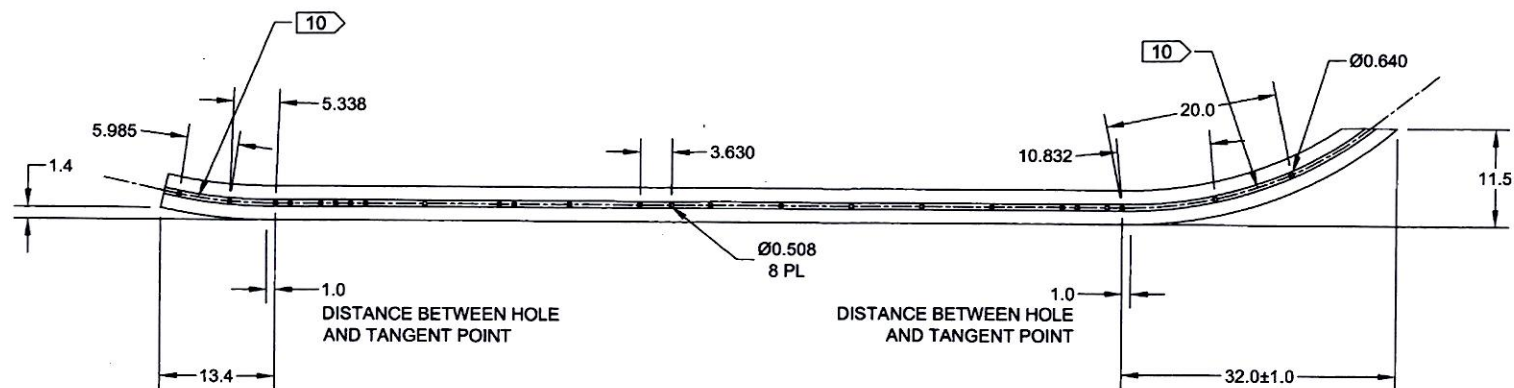

D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	A	D2580	SHEET 8 OF 9
APPROVED	W.P.	TITLE	SCALE
DE APPR.	A	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

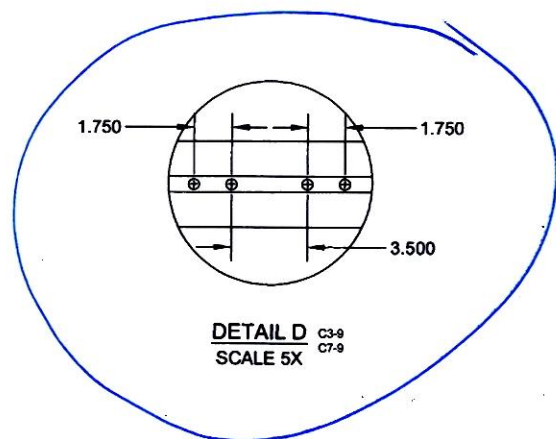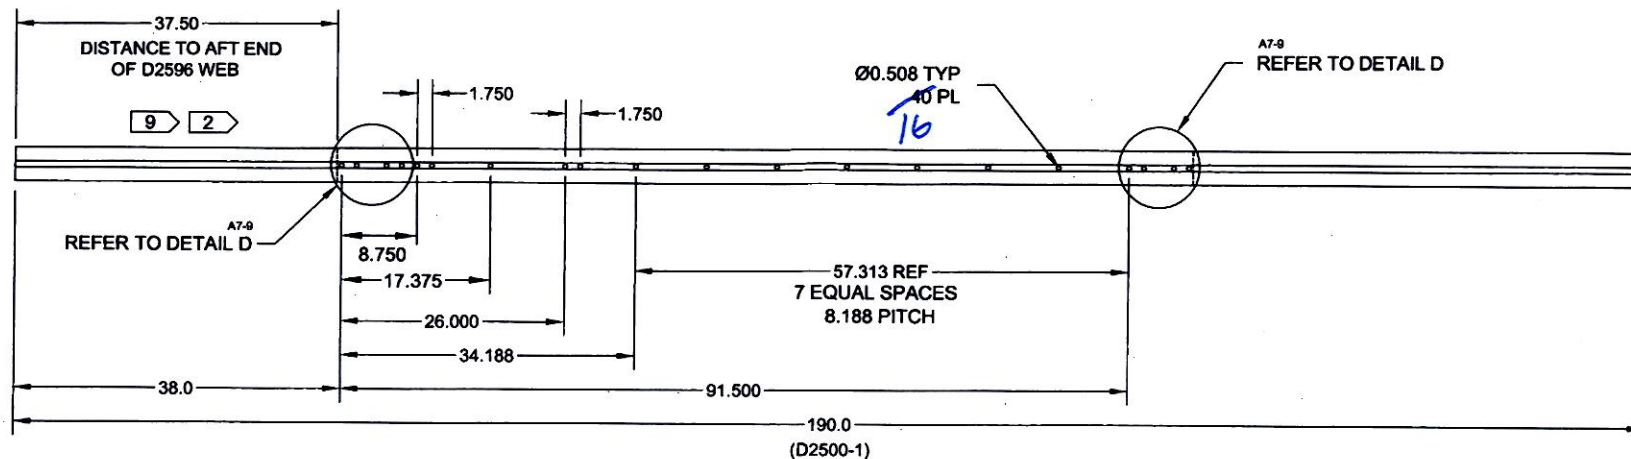

D2580-101 TUBE

*Drilling Drill saddle holes
only*
9/16/11/26

RELEASED
2014-04-29
W.D.

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	<i>A.P.</i>	DRAWING NO.	REV. G
MFG. APPR.	<i>AA</i>	D2580	SHEET 9 OF 9
APPROVED	<i>Am</i>	TITLE	SCALE
DE APPR.	<i>Am</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
		Completed By			
		Lead hand / Supervisor Approval Verification			
		QC / QA Coordinator Approval			
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

PARTS INSTALLED:

PART NO:	BATCH NO:	QUANTITY:
D3566-13	B151442	X1
D3564-13	B147966	X1
D3564-11	B151732	X1
D3564-9	B150310	X1
D3564-5	B147887	X1
D3566-1	B151632	X2
D3566-5	B147914	X1
ALS4-1032-130	M135442	X50
AN3C-4A	M135864	X50
NAS1149C033212	M135948	X50